

REMOTE DISPLAY The Original




Oval gear pulse meters
 Designed and realised to be used with the range of pulse meters. Remote installation is provided by simply connecting 2 wires. A large screen simultaneously displays the quantity delivered and the non resettable total. The Remote Display also comes with software applications for calibrating flow metres.
 It is available both as a basic display device and as a pulse emitter. It is indispensable when the receiver only recognises discrete quantities of pulses. The remote display is the ideal addition to our series of pulse meters wherever display and reading of the quantities delivered are indispensable, not directly at the point of installation of the flow meters, but over a distance. With their easy interfacing management systems, pulse transmitter models connected to Remote Display extend the field of application of pulse meters.

- Specifications**
- Single display with 5 figure partial Total (h=11.5 mm) floating point (0.001 to 99999) and 8 figure non resettable Total (h = 5 mm, from 1 to 99999999).
 - Front sealing plate and display guard
 - Reset button and calibration
 - Battery or grid powered
 - Remote connection to pulse meter up to 15 metres.
 - Pulse out set in 1, 2, 10, 20, 50, 100 P/litre
 - Resettable total available
 - Different unit of measurement setting option
 - Low battery indication
 - Flow rate indication.

- Available models**
- Remote display with pulse transmitter
 - Battery powered 2 x 1.5 V
 - Outgoing signal type: open collector max 50 V, 1.2 Amp, single channel,
 - Grid powered 4-12 V dc, 1.2 Amp
 - Outgoing signal type: open collector max 50 V, 1.2 Amp, single channel.
 - To remotely show the quantity dispensed. Connected to the Puls out version (up to 100 m) with the RESET button synchronized (once one display is reset, the same happens to the other).



Lubrication Solutions Inc
 19703-B Eastex Freeway
 #100
 Humble TX 77338
 Phone 281-619-8109
 www.lsidef.com

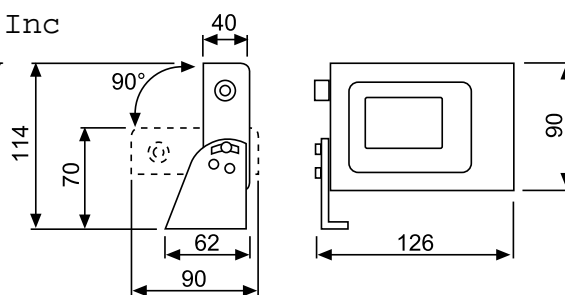

REMOTE DISPLAY

Code	Description	Suitable for Pulse meter	Pulser versions
F1175200A	Remote displ. Pulse out K600	K600 diesel	Pulse out
F1175300A	Remote displ. Pulse out K600/4	K600/4	Pulse out
F1175400A	Remote displ. Pulse out K700	K700	Pulse out
F0049501A	Universal displ. Pulse out	K200, K400, K600 oil, K600 diesel, K600/4, K700	Pulse out
F0049502A	Display Pulse in	For all Piusi Pulse out remote display	Pulse in
F0045903B	Display Pulse out UREA	Turbinox	Pulse out

